


Lee Floorstok Unit B1 The Dresser Centre Whitworth Street Manchester M11 2NE Tel: 0161 231 8080 Fax: 0161 231 8787 Email: leefloor@aol.com Web: leefloorstok.com

Product Specification & Cleaning Guide

SO SAFETY

DURABLE VINYL SAFETY FLOORING

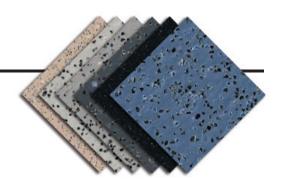

SPECIFICATIONS

CONSTRUCTION	STANDARDS	
DESCRIPTION		
Construction		compact heterogeneous
Total thickness	EN ISO 24346	2.0 mm
Wear layer thickness	EN ISO 24340	0.7 mm
Width of roll	EN ISO 24341	2 m
Length of roll	EN ISO 24341	20 lm
Total weight	EN ISO 23997	2.7 kg/m ²
CLASSIFICATION		
European classification	EN ISO 10874	Class 34/43
PERFORMANCE		
Abrasion Group	MSZ EN 660-1	Т
Residual indentation	EN ISO 24343	max 0.1 mm
Dimensional stability	EN ISO 23999	max 0.2%
Fire resistance	EN 13501-1	class: Bfl-s1
	ASTM E 648/662	class: Class1/pass
	Gost 30402-94	class: G1
Slip resistance	DIN 51130	R10
	ASTM D2047-99	dry 0.92/wet 0.84
	EN 13893	class: DS
	RRL Pendulum test	>36 (wet test)
Abrasion resistance (h-18 wheel)	ASTM D3884-01	-0.19g/1000 circle
Abrasion resistance	ISO 9352	-0.25g/1000 circle
Chemical resistance	EN ISO 26987	✓
	ASTM F925-02	✓
Light fastness	EN ISO 105-B02	grade 6
Castor chair resistance	EN ISO 4918	✓
Anti-bacterial and fungicid treatment		✓
Seaming method		heat or cold weld

CLEANING GUIDE

- 1. Remove any debris.
- 2. Remove all surface dust grit by sweeping or vacuum.
- Apply a solution of neutral cleanser (or alkaline cleanser, dependent upon the level of grease or oily contaminates), diluted to the manufacturer's instructions, with a spray over the section to be cleaned. Leave sufficient time to react with the soiling.
- 4. Pick up the solution with a clean microfiber mop, using a continuous side-to-side motion. When the mop head becomes loaded, it will start streaking the floor. At this point the dirty mop head should be removed and placed into a laundry bag and clean mop head fitted. The cycle should then be repeated until the whole floor is completed.
- The dirty mop head should then be laundered, in preparation for reuse.
- Where detergent residue remains on the floor surface, the areas should be rinsed completely with clean, warm water, picked up with a wet vacuum and to dry thoroughly.
- The maximum benefits are derived from this system by carrying out this quick and simple procedure on a daily basis and by using clean equipment each time, to maximise dirt pick-up and eliminate streaking.
- In areas subject to heavy soiling, machine scrubbing should be undertaken on a periodic basis, after neutral or alkaline cleanser has been applied to the floor, diluted to the manufacturer's instruction